


KRYTON INTERNATIONAL INC. 1645 EAST KENT AVE. VANCOUVER, BC V5P 2S8 TOLL FREE: 1-800-267-8280 PHONE: (604) 324-8280

> FAX: (604) 324-8899 www.kryton.com

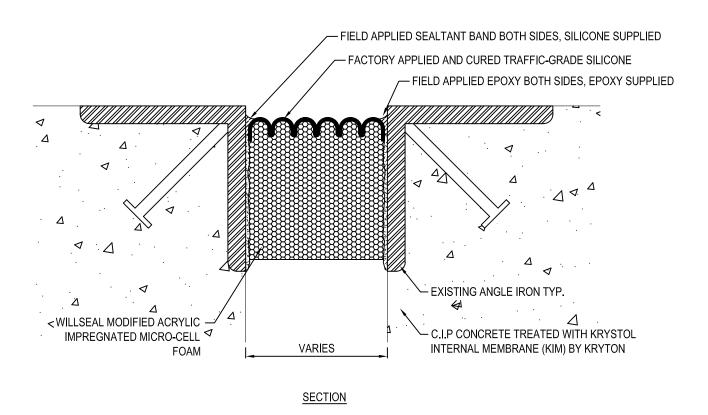

MANUFACTURER'S NOTES:

- 1. MAKE SURE JOINT IS SOUND AND IS FREE FROM SPALLING OR DAMAGES
- 2. APPLY DUCT TAPE ALONG JOINT EDGE
- 3. MIX THE SUPPLIED EPOXY IN A SEPARATE CONTAINER AT A 1:1 RATIO, MIX UNTIL UNIFORM IN COLOR, EPOXY MUST BE USED WITHIN A 30 MINUTE TIME FRAME.
- 4. APPLY EPOXY ALONG THE VERTICAL FACE WITHIN IN THE JOINT SUBSTRATE AT A 60 LFT PER GALLON YIELD
- 5. REMOVE PACKAGING MATERIAL, BEING SURE NOT TO PULL OR TWIST, USE MARGIN TROWELS TO INSTALL THE MATERIAL
- 6. OVERLAP EACH PROGRESSIVE SUPPLIED SPLICE ADHESIVE AT THE END OF EACH STICK, THE END OF EACH STICK SHOULD BE INSTALLED IN COMPRESSION
- 7. USING THE SUPPLIED SILICONE APPLY A FILLET BEAD, AT A RATE OF 80 LFT PER SAUSAGE, ALONG THE MATERIAL AND THE SUBSTRATE AS WELL AS THE SILICONE SPLICE SEAMS
- 8. REMOVE THE DUCT TAPE AND REMOVE ANY EXCESS EPOXY OR SILICONE LEFT ON THE SURFACE OF THE MATERIAL OR SUBSTRATE
- 9. PLEASE SEE MANUFACTURES INSTALL INSTRUCTIONS FOR FULL DETAILS

NOTES:

- 1. INSTALLATION TO BE COMPLETED IN ACCORDANCE WITH MANUFACTURER'S SPECIFICATIONS.
- 2. DO NOT SCALE DRAWING.
- 3. THIS DRAWING IS INTENDED FOR USE BY ARCHITECTS, ENGINEERS, CONTRACTORS, CONSULTANTS AND DESIGN PROFESSIONALS FOR PLANNING PURPOSES ONLY. THIS DRAWING MAY NOT BE USED FOR CONSTRUCTION.
- 4. ALL INFORMATION CONTAINED HEREIN WAS CURRENT AT THE TIME OF DEVELOPMENT BUT MUST BE REVIEWED AND APPROVED BY THE PRODUCT MANUFACTURER TO BE CONSIDERED ACCURATE.
- 5. CONTRACTOR'S NOTE: FOR PRODUCT AND COMPANY INFORMATION VISIT www.CADdetails.com/info AND ENTER REFERENCE NUMBER 5104-053



5104-053 REVISION DATE 13/04/2018